

# Manhole Inspection Summary

Manhole # S31C\_\_002MH

Printed On: 6/10/2009

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **31C** Node: **002** Status: **Found**

Insp Date: **5/26/09 3:36 PM**

Incomplete Comments

Crew: **ADS1**  
Inspector: **ADS1**  
Firm: **ADS**

**Location** Address: **MULBRRY ST**

Cross Street: **PACA ST**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **HEAVY TRAFFIC INTERSECTION**

**Cover** Shape: **Circular** Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **1** (in.)  
**75**

Type: **Sanitary** Condition: **Worn** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **3** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **10** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **38** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **8** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


# Manhole Inspection Summary

Manhole # S31C\_\_002MH

Printed On: 6/10/2009

Page 2 of 3

Location View

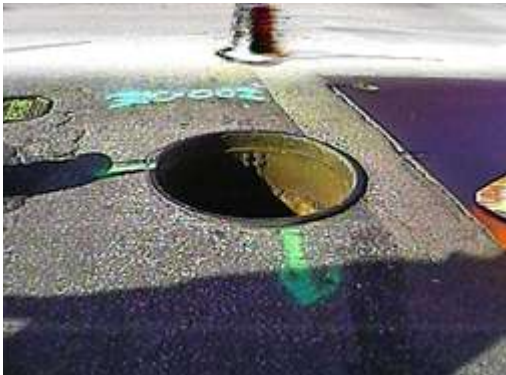

Top View



Defect 1



BARREL WALL MISSING BRICK

Defect 2



FRAME OFFSET

Defect 4



DETERIORATED CHIMNEY

Defect 3



WORN COVER

## Manhole Inspection Summary

Manhole # S31C\_\_002MH

Printed On: 6/10/2009

Page 3 of 3

10 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.10** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.09** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection